TEXAS 37

SAN ANTONIO INTL (SAT)(KSAT) 7 N UTC-6(-5DT) N29°32.04′ W98°28.14′

809 B LRA Class I, ARFF Index C NOTAM FILE SAT RWY 04-22: H8505X150 (CONC-GRVD) S-95, D-190, 2S-175,

2D-270 PCN 91 R/B/W/T HIRL CL

**RWY 04:** MALS. PAPI(P4R)—GA 3.0° TCH 79'. RVR-T Pole. 0.3% down

RWY 22: REIL. PAPI(P4L)—GA 3.0° TCH 85'. RVR-R 0.5% up.
RWY 13R-31L: H8502X150 (CONC-GRVD) S-95, D-190, 2D-270
PCN 86 R/B/W/T HIRL CL

RWY 13R: ALSF2. TDZL. PAPI(P4L)—GA 3.0° TCH 75′. RVR-TMR RWY 31L: MALSR. PAPI(P4L)—GA 3.0° TCH 82′. RVR-TMR Bldg. RWY 13L-31R: H5519X100 (ASPH) S-59, D-120 PCN 61 F/C/W/T

RWY 13L: REIL. PAPI(P4L)-GA 3.0° TCH 40'.

RWY 31R: REIL. PAPI(P4L)—GA 3.0° TCH 60'.

## RUNWAY DECLARED DISTANCE INFORMATION

 RWY 04: TORA-8505
 TODA-8505
 ASDA-8505
 LDA-8505

 RWY 13L+TORA-5519
 TODA-5519
 ASDA-5519
 LDA-5519


 RWY 13R+TORA-8502
 TODA-8502
 ASDA-8502
 LDA-8502

 RWY 21: TORA-8505
 TODA-8505
 ASDA-8500
 LDA-8502

 RWY 31L+TORA-8502
 TODA-8502
 ASDA-8502
 LDA-8502

 RWY 31R+TORA-5519
 TODA-5519
 ASDA-5519
 LDA-5519

SERVICE: S4 FUEL 100LL, JET A 0X 1, 2, 3, 4

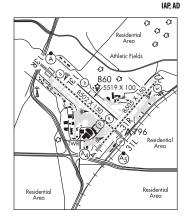

AIRPORT REMARKS: Attended continuously. Numerous flocks of birds invof arpt. Glider/soaring ops aprx 17 miles northwest of arpt dur VFR. Rwy 13L-31R not avbl part 121 for air carrier ops. Work in progress scheduled maintenance on and along twys and ramps areas at various times. Aerodrome all sfc work in progress for current info ctc ops 210-413-4928. Arpt restricted to acft with wingspan greater than 171', PPR with 24hr OPS 210-413-4928 required for authorization. PPR with arpt ops for acft powering back from terminal gates. All acft after ldg on Rwy 13R-31L exiting southeast bound on Twy D to make 90° turn on Twy G to avoid newly laid unusable sfc. Acft taxiing on Rwy 04 northeast bound look for hold short to Rwy 31L. Acft taxiing on Twy N southwest bound look for hold short to Rwy 31R. Apron East Cargo Ramp intersection of Rwy 04-22 and Twy D aircraft are requested to apply the minimum thrust when crossing the rwy to avoid damage due to jet blast. The following twys are not avbl for acft 59,000 lbs or over: Twy A and Twy J north of Rwy 13R-31L, Twy M and Twy P, Twy H northwest of Twy Z and Twy E east of Rwy 04-22. Twy R west of Twy D clsd to acft over 270,000 lbs. Compass deviation may occur at the northwest portion of Twy R due to rebar reinforced conc bridge located under the twy. Inner ramp taxilane east of Terminal A is clsd to acft with wingspan greater than 135' exc for acft crossing the inner ramp to gates A1 to A5. Inner taxilane north of Teminal A and B is clsd to acft with wingspan greater than 135'. Acft at Terminal A and B advise gnd ctl prior to push. Twy G btn Twy W and Rwy 04-22 clsd to acft wingspan more than 135'. Twy L clsd northbound. Twys L and B clsd to acft with wingspans greater than 118' exiting Rwy 31L. Twy D non-movement area from Twy N to 500' west of Twy N. Twy R btn apch end Rwy 13L and Twy D clsd to acft wingspan more than 135'. Twy S btn apch end Rwy 13L and Rwy 13R-31L clsd to acft wingspan more than 135'. Twy Z clsd to acft with wingspan greater than 118'. A barricaded pavement elev chg exists along the eastern side of the west ramp. Frequent rubber accumulation northwest 2500' Rwy 13R-31L. NS ABTMT Noise sensitive areas exist on all sides of arpt, at pilots discretion climb as quickly and quietly as safely possible on departure and use consideration when flying over populated areas by minimizing flt and high pwr settings. Military aircraft: Departing and arriving aircraft will use minimum power settings consistent with aircraft flight manuals, afterburner takeoff is prohibited unless required for safety of flight. Engine run-ups are permitted btn 1200-0500Z‡. Gnd run-up enclosure avbl 24 hrs. Terminal Gates A1, A5, A6, A7 and A8 use only with PPR call ops 210-413-4928. C130 and C141 type acft shall park on west ramp to clear cstms. All intl general aviation clear U.S. Cstms at North Fixed Base Operator Ramp east side, call U.S. CSTMS 210-821-6965 upon arr. Flight Notification Service (ADCUS) available. NOTE: See Special Notices—Continuous Power Facilities

AIRPORT MANAGER: 210-207-3450

WEATHER DATA SOURCES: ASOS (210) 805-5583 HIWAS 116.8 SAT. WSP.

COMMUNICATIONS: D-ATIS 118.9 UNICOM 122.95

RCO 122.3 (SAN ANGELO RADIO)

® APP/DEP CON 128.05 (091°–140°) 125.1 (271°–359°) 124.45 (360°–090°) 118.05 (141°–270°)

TOWER 119.8 GND CON 121.9 CLNC DEL 126.7

CPDLC (LOGON KUSA)

AIRSPACE: CLASS C svc ctc APP CON

VOR TEST FACILITY (VOT) 110.4

RADIO AIDS TO NAVIGATION: NOTAM FILE SAT.

(H) VORTACW 116.8 SAT Chan 115 N29°38.64′ W98°27.68′ 176° 6.6 NM to fld. 1160/8E. HIWAS.

ALAMO NDB (LOMW) 368 AN N29°36.46′ W98°34.18′ 126° 6.9 NM to fld. 960/4E.

ILS/DME 109.7 I-SAT Chan 34 Rwy 04. Class IB. Unmonitored.

ILS/DME 110.9 I–ANT Chan 46 Rwy 13R. Class IIE. LOM ALAMO NDB. DME also serves Rwy 31L. DME unusable 20° right of course.

ILS/DME 110.9 I-IZR Chan 46 Rwy 31L. Class IA. DME also serves Rwy 13R.

SC, 29 MAR 2018 to 24 MAY 2018

SAN ANTONIO H-7B, L-19C