

MELBOURNE INTL (MLB)(KMLB) 2 NW UTC-5(-4DT) N28°06.17' W80°38.72'

33 B Class I, ARFF Index C NOTAM FILE MLB

RWY 09R-27L: H10181X150 (ASPH-GRVD) S-100, D-165, 2S-175, 2D-300 PCN 61 F/B/W/T HIRL CL**RWY 09R:** MALSR. TDZL. PAPI(P4L)—GA 3.0° TCH 83'. RVR-T**RWY 27L:** REIL. PAPI(P4L)—GA 3.0° TCH 54'. RVR-R Thld dsplcd 699'.**RWY 09L-27R:** H6000X150 (ASPH) S-60, D-60 PCN 16 F/B/Y/T MIRL**RWY 09L:** PAPI(P4L)—GA 3.0° TCH 39'.**RWY 27R:** PAPI(P4L)—GA 3.0° TCH 40'.**RWY 05-23:** H3001X75 (ASPH) S-26 PCN 9 F/A/Y/T MIRL**RWY 05:** PAPI(P2L)—GA 3.0° TCH 21'.**RWY 23:** PAPI(P2L)—GA 3.0° TCH 21'.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 05:** TORA-3000 TODA-3000 ASDA-3000 LDA-3000**RWY 09L:** TORA-6000 TODA-6000 ASDA-6000 LDA-6000**RWY 09R:** TORA-10181 TODA-10181 ASDA-10181 LDA-10181**RWY 23:** TORA-3000 TODA-3000 ASDA-3000 LDA-3000**RWY 27L:** TORA-10181 TODA-10181 ASDA-10181 LDA-9481**RWY 27R:** TORA-6000 TODA-6000 ASDA-6000 LDA-6000**SERVICE:** S4 FUEL 100LL, JET A LGT When twr clsd ACTIVATE Rwy 09R-27L HIRL, Rwy 09L-27R MIRL, Rwy 05-23 MIRL and PAPI Rwy 05, Rwy 09L, Rwy 09R, Rwy 23, Rwy 27L, Rwy 27R—CTAF.**AIRPORT REMARKS:** Attended continuously. Bird activity on and invof the arpt. Sfc condition no reported 0400-1100Z‡ (2300-0600 lcl). Touch and go ops rstd after 0200Z‡ or 2 hrs after SS (whichever is later). Unctd areas incl Twy V, West of Rwy 05, Twy C, North of Twy G, Twy H, Twy K and Twy S. Rwy 27L RVR unavailable 0500-1100Z‡. U.S. CSTMS user fee arpt.**AIRPORT MANAGER:** 321-723-6227**WEATHER DATA SOURCES:** ASOS (321) 723-7403 LAWRS.**COMMUNICATIONS:** CTAF 118.2 ATIS 132.55 UNICOM 122.95

RCO 122.1R 110.0T (Saint Petersburg Radio)

RCO 122.6 (Saint Petersburg Radio)

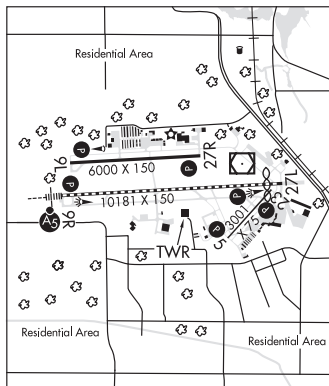
② ORLANDO APP/DEP CON 132.65

TOWER 118.2 124.05 (1100-0500Z‡) **GND CON** 121.9 **CLNC DEL** 121.9 132.65 (when twr clsd)**AIRSPACE:** CLASS D svc 1100-0500Z‡ other times CLASS G.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MLB.

(L) VOR/DME 110.0 MLB Chan 37 N28°06.32' W80°38.12' at fld. 30/7W.

SATELLITE NDB (HW) 257 SQT N28°05.97' W80°42.05' 092° 3.0 NM to fld. 18/6W.

ILS 108.3 I-MLB Rwy 09R. Unmonitored.

**JACKSONVILLE****H-81, L-24F****IAP, AD****MERRITT ISLAND** (COI)(KCOI) 0 S UTC-5(-4DT) N28°20.50' W80°41.13'

6 B LRA NOTAM FILE PIE

RWY 11-29: H3601X75 (ASPH) S-22 MIRL**RWY 11:** PAPI(P2L)—GA 3.0° TCH 30'. Bldg.**RWY 29:** PAPI(P2L)—GA 3.0° TCH 31'. Boat.**SERVICE:** S4 FUEL 100LL, JET A LGT ACTIVATE rotating bcn and MIRL Rwy 11-29—CTAF.**AIRPORT REMARKS:** Attended 1300-0100Z‡. Banner towing invof arpt. 24 hr helicopter ops SW ramp. Patrick Air Force Base (COF) Class D airspace is in close proximity to Merritt Island Arpt and (COF) crossing Rwy 11-29 has same orientation as Merritt Island Arpt.**AIRPORT MANAGER:** 321-267-8780**WEATHER DATA SOURCES:** AWOS-3 119.025 (321) 986-8864.**COMMUNICATIONS:** CTAF/UNICOM 122.975

② ORLANDO APCH APP/DEP CON 134.95

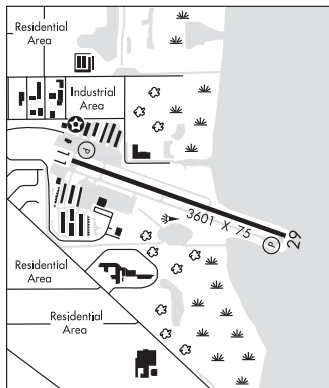
RADIO AIDS TO NAVIGATION: NOTAM FILE ORL.**ORLANDO (H) VORTACW** 112.2 ORL Chan 59 N28°32.56' W81°20.10' 109° 36.4 NM to fld. 102/OE. **HIWAS.**

TACAN AZIMUTH unusable:

066°-084°

246°-289° byd 17 NM blo 2,000'

246°-289° byd 28 NM blo 2,500'

**JACKSONVILLE****L-24F****IAP**