

LAKELAND

LAKELAND LINDER RGNL (LAL)(KLAL) 4 SW UTC-5(-4DT) N27°59.34' W82°01.11'

MIAMI
H-8H, L-21D, 24F
IAP, AD

142 B Class I, ARFF Index B NOTAM FILE LAL

RWY 09-27: H8499X150 (ASPH-GRVD) S-105, D-170, 2S-175

PCN 40 F/A/X/T HIRL

RWY 09: MALSR. PAPI(P4R)—GA 3.0° TCH 52'.

RWY 27: PAPI(P4L)—GA 3.0° TCH 45'.

RWY 05-23: H5005X150 (ASPH-GRVD) S-94, D-150, 2S-93

PCN 35 F/A/X/T HIRL

RWY 05: PAPI(P4L)—GA 3.0° TCH 56'.

RWY 23: PAPI(P4L)—GA 3.0° TCH 50'. Tree.

RWY 08-26: 2205X60 (TURF)

RWY 08: Thld dsplcd 360'.

RWY 26: Thld dsplcd 555'.

LAND AND HOLD—SHORT OPERATIONS

LDG RWY	HOLD—SHORT POINT	AVBL LDG DIST
RWY 05	09-27	2500
RWY 09	05-23	6000

RUNWAY DECLARED DISTANCE INFORMATION

RWY 08: TORA-1650 TODA-2010 ASDA-2205 LDA-1845

RWY 09: TORA-8499 TODA-8499 ASDA-8414 LDA-8414

RWY 26: TORA-1845 TODA-2205 ASDA-2205 LDA-1650

RWY 27: TORA-8499 TODA-8499 ASDA-8499 LDA-8499

SERVICE: S4 FUEL 100LL, JET A OX 1, 2 LGT ACTIVATE HIRL Rwy 05-23, HIRL Rwy 09-27 and MALSR Rwy 09—CTAF. PAPI Rwy 05, Rwy 09, Rwy 23, and Rwy 27 opr continuously. Twy D, Twy E, Twy F, Twy P unlgtd.

AIRPORT REMARKS: Attended 1100-0300Z†. Extv bird act on and invof arpt. Rwy 08-26 restricted to Group 1 acft, VFR daytime only, no touch and goes, PPR 863-834-4911. U.S. CSTMS user fee arpt. PPR US CSTMS svc Thur-Mon; 1630-0100Z‡ call 863-647-4870; after hours fee charged.

AIRPORT MANAGER: 863-834-3298

WEATHER DATA SOURCES: AWOS-3PT 118.025 (863) 834-2030. LAWRWS.

COMMUNICATIONS: CTAF 124.5 ATIS 118.025 UNICOM 122.95

RCO 122.1R 116.0T (SAINT PETERSBURG RADIO)

® TAMPA APP/DEP CON 120.65 119.9

TOWER 124.5 (1100-0300Z)‡ GND CON 121.4

AIRSPACE: CLASS D svc 1100-0300Z‡ other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE LAL.

(H) VORTAC 116.0 LAL Chan 107 N27°59.17' W82°00.83' at fld. 134/1E.


TACAN AZIMUTH unusable:

321°-339° blo 6,000'

VOR unusable:

070°-100° byd 35NM blo 1,400'

ILS/DME 110.1 I-LAL Chan 38 Rwy 09. Class IE.

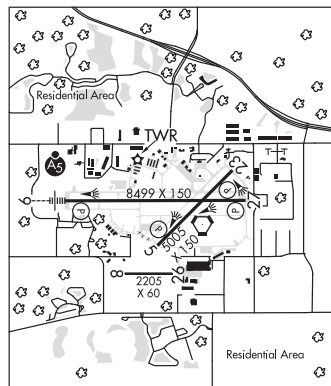

SOUTH LAKELAND (X49) 1 S UTC-5(-4DT) N27°56.00' W82°02.64'

MIAMI

110 NOTAM FILE PIE

RWY 14-32: 2412X100 (TURF)

RWY 14: Tree. Rgt tfc.

RWY 32: Tree.

SERVICE: S2 FUEL , UL94

AIRPORT REMARKS: Attended Sat-Sun 1200-dusk. Ultralgt activity on invof arpt. No skydiving, pwr parachute or gyro ops without written permission from arpt owner. Rwy 14-32 white pails outline landing strip. Thlds marked with 3 white pails perpendicular to cntrln. Arpt has no ngt time ops. Turf rwys may hold water after rain. Arpt is emerg evac site. Watch for emerg acft and vehicles on rwy and invof arpt. Rwy 14-32 road 97' to 100' south of centerline at full length of rwy.

AIRPORT MANAGER: 863-701-0000

COMMUNICATIONS: CTAF 122.9

LEE CO N26°31.79' W81°46.55' NOTAM FILE RSW.

MIAMI

(L) VORTAC 111.8 RSW Chan 55 073° 1.2 NM to Southwest Florida Intl. 25/2W. HIWAS.

H-8H, L-21D, 23A, 23B