

## MOLINE

**QUAD CITY INTL** (MLI)(KMLI) 3 S UTC-6(-5DT) N41°26.90' W90°30.45'

590 B LRA ARFF Index—See Remarks NOTAM FILE MLI

**RWY 09-27:** H10002X150 (CONC-GRVD) S-100, D-173, 2S-175,

2D-353 PCN 78 R/B/W/T HIRL

**RWY 09:** MALSR. PAPI(P4L)—GA 3.0° TCH 50'. RVR-TR

**RWY 27:** MALSR. PAPI(P4L)—GA 3.0° TCH 52'. RVR-TR Tree.

**RWY 13-31:** H7301X150 (ASPH-CONC-PFC) S-60, D-140, 2S-175,

2D-200 PCN 54 R/B/W/T HIRL

**RWY 13:** REIL. PAPI(P4L)—GA 3.0° TCH 45'. Tree.

**RWY 31:** REIL. PAPI(P4L)—GA 3.0° TCH 45'. Thld dsplcd 522'. Tree.

**RWY 05-23:** H5016X150 (CONC-GRVD) S-60, D-75, 2S-95, 2D-120

PCN 18 R/B/W/T MIRL

**RWY 05:** PAPI(P4L)—GA 4.0° TCH 46'. Tree.

**RWY 23:** PAPI(P4R)—GA 3.0° TCH 38'. Road.

**RUNWAY DECLARED DISTANCE INFORMATION**

**RWY 05:** TORA-5015 TODA-5015 ASDA-5015 LDA-5015

**RWY 09:** TORA-10002 TODA-10002 ASDA-10002 LDA-10002

**RWY 13:** TORA-7301 TODA-7301 ASDA-7032 LDA-7032

**RWY 23:** TORA-5015 TODA-5015 ASDA-5015 LDA-5015

**RWY 27:** TORA-10002 TODA-10002 ASDA-10002 LDA-10002

**RWY 31:** TORA-7301 TODA-7301 ASDA-6954 LDA-6432

**SERVICE:** S4 FUEL 100LL, JET A LGT When twr clsd HIRL Rwy 09-27

and Rwy 13-31 preset on med ints. ACTIVATE and incr ints REIL Rwy 13 and Rwy 31, MALSR Rwy 09 and Rwy 27—CTAF.

**AIRPORT REMARKS:** Attended continuously. Birds and migratory fowl on and invof arpt. Snow removal ops in progress winter months, vehicle operators will monitor CTAF. Rwy 05-23 not avbl for sked air carrier ops involving acft designed for 10 or more passenger seats and unsked air carrier ops involving acft designed for 31 or more seats. Class I, ARFF Index B. ARFF index C available on request; 24 hr PPR call arpt manager 309-757-1739. Rwy 05-23 not avbl for air carrier ops greater than 9 seats except for taxi ops. Landing acft should use caution where all rwys intersect not to exit on the rwy at this intersection. Ensure you are exiting on to a twy and not a rwy. Rwy incursion risk. Pilots are reminded to review arpt hot spot info before taxiing for dep and before Indg. See terminal procedures publication arpt diagram and AFD section on hot spots for additional info.

**AIRPORT MANAGER:** 309-764-9621

**WEATHER DATA SOURCES:** ASOS (309) 799-7096 LLWAS.

**COMMUNICATIONS:** CTAF 119.4 ATIS 121.2 UNICOM 122.95

**MOLINE RCO** 122.6 (KANKAKEE RADIO)

Ⓡ **QUAD CITY APP/DEP CON** 133.275 (SOUTH OF ACTIVE RWY) 125.95 (NORTH OF ACTIVE RWY) (1130-0430Z± other times ctc)

Ⓡ **CHICAGO CENTER APP/DEP CON** 118.75

**TOWER** 119.4 (1130-0430Z±) **GND CON** 121.9 **CLNC DEL** 124.05

**AIRSPACE:** CLASS C svc ctc **APP CON** svc 1130-0430Z± other times CLASS E.


**RADIO AIDS TO NAVIGATION:** NOTAM FILE MLI.

**MOLINE (L) VORV/DME** 114.4 MZV Chan 91 N41°19.26' W90°38.29' 033° 9.7 NM to fld. 817/5E.

**ILS/DME** 110.5 I-MLI Chan 42 Rwy 09. Class IB. Unmonitored when ATCT closed.

**ILS/DME** 110.5 I-GEQ Chan 42 Rwy 27. Class IB. Unmonitored when ATCT closed.

**ASR**

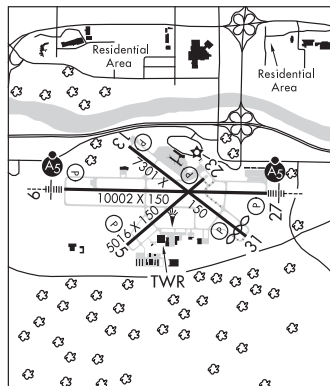

**QUAD-CITY SPB** (I04) 2 S UTC-6(-5DT) N41°27.60' W90°29.57'

**CHICAGO**

560 TPA—960(400) NOTAM FILE IKK

**WATERWAY E-W:** 10000X300 (WATER)

**WATERWAY E:** Rgt tfc.

**SERVICE:** S2 FUEL 100LL

**SEAPLANE REMARKS:** Unattended. Radio or phone approval req by Moline twr. Call for svc and 100LL 304-314-0002. Svc by prior agreement. Waterway E p-line crosses river 300' E of hangar and dock area; highway bridge 300' W of hangar and dock area.

**AIRPORT MANAGER:** 309-517-4500

**COMMUNICATIONS:** CTAF 122.9

**COMM/NAV/WEATHER REMARKS:** Tfc information avbl from Quad City twr on 119.4. Individual ops must be approved by Quad City twr on 119.4 or by telephone.

**MOLINE** N41°19.26' W90°38.29' NOTAM FILE MLI.

**CHICAGO**

(L) VORV/DME 114.4 MZV Chan 91 033° 9.7 NM to Quad City Intl. 817/5E.

**H-5D, L-28B**

**RCO** 122.6 (KANKAKEE RADIO)